


## Power Steering Binding or Lack of Assist After Installation

**Application** All vehicles with Power Steering.

**Problem** Binding, poor return ability, leaking, stiff steering, noise or fluid overheating.

Cause Restricted flow of hydraulic fluid. Kinked or damaged line or accumulation of grit and debris, block proper flow of fluid through Power Steering System.

Check hose routing and condition. Make sure all lines are O.E. Specification. Before installing any replacement unit, flush the entire system and replace **ALL** hoses.

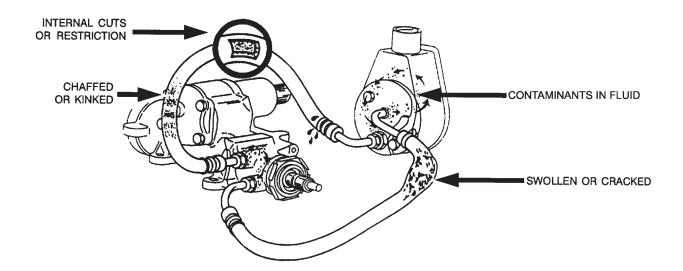

Note

Solution

CONTAMINATED FLUID COULD CAUSE THE SAME SYMPTOMS. ALWAYS FLUSH THE ENTIRE SYSTEM AND INSTALL A POWER STEERING FILTER.

©2020 CARDONE Industries, Inc. ProTech® is a registered trademark owned by CARDONE Industries, Inc. CARDONE™ is a pending trademark registration owned by CARDONE Industries, Inc.

JDB0354 PT 20-0004